

MODEL: 105099-100/200/102/202 Ladies Trouser




Finished measures before washing

	Size	34	36	38	40	42	44	46	48	50	52	54	56	58	60	62	64	Tolerance
A	1/2 Waist width	37	39	41	43	45	47	49	51	53	55	57	59	61	63	65	67	-0/+1,0 cm
B	1/2 Hip width	49	50	52	53,5	55,5	57,5	59	61	63	65	67,5	70	72	75	77	79	+/- 1,0 cm
E1	Rise (Help measure for hip)	12,5	13	14	14,5	15	15,5	16	17	18	19	20	21	21,5	22,5	23,5	24,5	
C	Side length	101	101	102	103	103	104	104	105	106	107	108	109	110	111	112	113	+/- 1,5 cm
	Side length + 10	110,5	111	112	112,5	113	113,5	114	115	116	117	118	119	119,5	120,5	121,5	122,5	+/- 1,5 cm
D	Crotch length	82	82	82	82	82	82	82	82	82	82	82	82	82	82	82	82	+/- 1,5 cm
	Crotch length + 10	92	92	92	92	92	92	92	92	92	92	92	92	92	92	92	92	+/- 1,5 cm

Last edited: 07.06.16. D.V.

E1*	How deep hip measure shall be taken from waist
C	Measured excl.waistband
D	Measured from crotch seam to bottom of leg

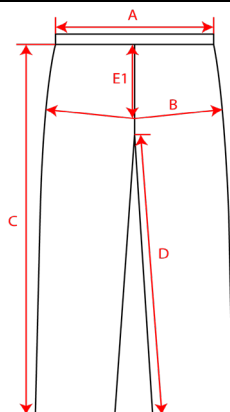

Please note: Not all sizes are available in stock program. We advise to contact NYBO WORKWEAR A/S customer service or homepage.

Please note: Final measures will depend on tolerance in garment making (See above), and measuring method (+/- 0,5 cm)
 Also note: Washing and drying conditions in industrial laundering can further more give a shrinkage of up to 3-5 % (Depending of material)
 Please also consult our recommendation for industrial washing/drying on www.nybo.com.